

information specified in Airbus A300 Airworthiness Limitations Section (ALS), Part 2—Damage Tolerant Airworthiness Limitation Items (DT—ALI), Revision 03, dated August 28, 2017. The initial compliance times for doing the tasks are at the applicable times specified in Airbus A300 Airworthiness Limitations Section (ALS), Part 2—Damage Tolerant Airworthiness Limitation Items (DT—ALI), Revision 03, dated August 28, 2017, or within 90 days after the effective date of this AD, whichever occurs later.

#### (h) No Alternative Actions or Intervals

After accomplishment of the revision required by paragraph (g) of this AD, no alternative actions (e.g., inspections) or intervals, may be used unless the actions or intervals are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (j)(1) of this AD.

#### (i) Terminating Action

Accomplishing the action in paragraph (g) of this AD terminates the requirements of AD 2017–04–05.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2017–0207, dated October 12, 2017, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0414.

(2) For more information about this AD, contact Dan Rodina, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3225.

(3) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on May 11, 2018.

**Michael Kaszycki**,

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–11140 Filed 5–24–18; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2018–0415; Product Identifier 2017–NM–149–AD]

RIN 2120–AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all The Boeing Company Model 737–100, –200, –200C, –300, –400, –500 series airplanes. This proposed AD was prompted by the results of a fleet survey that revealed cracking in the bulkhead frame web at a certain body station. This proposed AD would require repetitive inspections of the bulkhead frame web at a certain station, and repair if necessary. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by July 9, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5

p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminster Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0415.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0415; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** George Garrido, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5232; fax: 562–627–5210; email: [george.garrido@faa.gov](mailto:george.garrido@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2018–0415; Product Identifier 2017–NM–149–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

We have received a report indicating that the results of a fleet survey revealed cracking in the bulkhead frame web at a certain body station. Boeing performed a fleet survey on retired Model 737-300 airplanes and inspected the upper bulkhead frame at station (STA) 259.5. One airplane had two cracks in the bulkhead frame web at fasteners connecting the bulkhead frame web to the outer chord between stringers S-11 and S-12 on the right side of the airplane. The cracks measured 0.45 inch and 1.7 inches in length, and the airplane had accomplished 73,655 total flight cycles at the time of inspection. A second airplane, which had accomplished 73,290 total flight cycles at the time of inspection, had two cracks in the right side bulkhead frame web measuring 1.772 inches and 0.219 inch in length, and one crack in the left side bulkhead frame web measuring 1.64 inches. Cracks have been reported on a total of five airplanes that had accomplished 60,640 to 73,655 total flight cycles. The cracks are a result of fatigue caused by cyclic pressurization of the fuselage. This condition, if not corrected, could result in reduced structural integrity of the airplane.

**Related Service Information Under 1 CFR Part 51**

We reviewed Boeing Alert Requirements Bulletin 737-53A1369

RB, dated October 12, 2017. The service information describes procedures for repetitive high frequency eddy current inspections and low frequency eddy current inspections and repair of the STA 259.5 bulkhead frame web from the first stiffener above stringers S-10 to S-13, on the left and right sides of the airplane. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA’s Determination**

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements**

This proposed AD would require accomplishment of the actions identified in the Boeing Alert Requirements Bulletin 737-53A1369 RB, dated October 12, 2017, described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for

and locating Docket No. FAA-2018-0415.

**Explanation of Requirements Bulletin**

The FAA worked in conjunction with industry, under the Airworthiness Directives Implementation Aviation Rulemaking Committee (AD ARC), to enhance the AD system. One enhancement is a process for annotating which steps in the service information are “required for compliance” (RC) with an AD. Boeing has implemented this RC concept into Boeing service bulletins.

In an effort to further improve the quality of ADs and AD-related Boeing service information, a joint process improvement initiative was worked between the FAA and Boeing. The initiative resulted in the development of a new process in which the service information more clearly identifies the actions needed to address the unsafe condition in the “Accomplishment Instructions.” The new process results in a Boeing Requirements Bulletin, which contains only the actions needed to address the unsafe condition (*i.e.*, only the RC actions).

**Costs of Compliance**

We estimate that this proposed AD affects 411 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspections .....	57 work-hours × \$85 per hour = \$4,845 per inspection cycle.	\$0	\$4,845 per inspection cycle .....	\$1,991,295 per inspection cycle.

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures

the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**The Boeing Company:** Docket No. FAA–2018–0415; Product Identifier 2017–NM–149–AD.

#### (a) Comments Due Date

We must receive comments by July 9, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to all The Boeing Company Model 737–100, –200, –200C, –300, –400, and –500 series airplanes, certificated in any category.

#### (d) Subject

Air Transport Association (ATA) of America Code 53; Fuselage.

#### (e) Unsafe Condition

This AD was prompted by the results of a fleet survey that revealed cracking in the bulkhead frame web at a certain body station. We are issuing this AD to detect and correct cracking in the station 259.5 bulkhead frame web from the first stiffener above stringers S–10 to S–13. Such cracking could result in reduced structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Required Actions

Except as required by paragraph (h) of this AD: At the applicable times specified in the “Compliance” paragraph of Boeing Alert Requirements Bulletin 737–53A1369 RB, dated October 12, 2017, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 737–53A1369 RB, dated October 12, 2017.

**Note 1 to paragraph (g) of this AD:** Guidance for accomplishing the actions required by this AD is included in Boeing Alert Service Bulletin 737–53A1369, dated October 12, 2017, which is referred to in Boeing Alert Requirements Bulletin 737–53A1369 RB, dated October 12, 2017.

#### (h) Exceptions to Service Information Specifications

(1) For purposes of determining compliance with the requirements of this AD: Where Boeing Alert Requirements Bulletin 737–53A1369 RB, dated October 12, 2017, uses the phrase “the original issue date of Requirements Bulletin 737–53A1369,” this AD requires using the effective date of this AD.

(2) Where Boeing Alert Requirements Bulletin 737–53A1369 RB, dated October 12, 2017, specifies contacting Boeing, this AD requires repair using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

#### (i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: [9-ANM-LAACO-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-LAACO-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

#### (j) Related Information

(1) For more information about this AD, contact George Garrido, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5232; fax: 562–627–5210; email: [george.garrido@faa.gov](mailto:george.garrido@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on May 11, 2018.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–11269 Filed 5–24–18; 8:45 am]

**BILLING CODE 4910–13–P**

#### DEPARTMENT OF TRANSPORTATION

#### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA–2018–0417; Product Identifier 2017–NM–132–AD]**

**RIN 2120–AA64**

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to supersede Airworthiness Directive (AD) 2016–25–03, which applies to certain Airbus Model A300 F4–600R series airplanes. AD 2016–25–03 requires repetitive high frequency eddy current (HFEC) inspections of the aft lower deck cargo door (LDCD) frame forks; a one-time check of the LDCD clearances; and a one-time detailed visual inspection of hooks, eccentric bushes, and x-stops; and corrective actions if necessary. Since we issued AD 2016–25–03, we have determined that accomplishing a new frame fork repair or reinforcement would allow an extension of the repetitive inspection intervals as would a frame fork replacement. This proposed AD would retain the actions required by AD 2016–25–03, with revised corrective actions and compliance times. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by July 9, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.