

Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on October 25, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-23594 Filed 11-3-22; 8:45 am]

BILLING CODE 4910-13-C

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-1407; Project Identifier MCAI-2022-01043-T]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all Airbus SAS Model A350-941 and -1041 airplanes. This proposed AD was prompted by reports of potential foreign object debris (FOD) contamination of the thermal relief valve (TRV). This proposed AD would require replacement of affected auxiliary power unit (APU) low pressure (LP) shut-off valves (SOVs), an inspection to detect fuel leaks of affected engine LP SOVs and APU isolation shut-off valves (ISOVs), and applicable corrective actions, and would prohibit installation of affected parts, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by December 19, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to regulations.gov. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5

p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA-2022-1407; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; website easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT:

Hassan Ibrahim, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3653; email Hassan.M.Ibrahim@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-1407; Project Identifier MCAI-2022-01043-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Hassan Ibrahim, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3653; email Hassan.M.Ibrahim@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2022-0157, dated August 4, 2022 (EASA AD 2022-0157) (also referred to as the MCAI), to correct an unsafe condition for all Airbus SAS Model A350-941 and -1041 airplanes. The MCAI states that reports have been received from the manufacturer of the APU, the engine LP SOV, and the APU ISOV of potential FOD contamination of the TRV, which was generated by a quality escape during the manufacturing assembly process. Results of the technical investigation determined that FOD in the TRV may lead to a fuel leakage through the valve. This condition, if not detected and corrected, could, in case of an APU or engine fire, contribute to an uncontrolled fire, possibly resulting in loss of control of the airplane.

The MCAI requires replacement of affected APU LP SOVs, a special detailed inspection (SDI) of affected engine LP SOVs and APU ISOVs to detect fuel leaks through the valve and, depending on findings, replacement with a serviceable engine LP SOV or APU ISOV.

You may examine the MCAI in the AD docket at regulations.gov under Docket No. FAA-2022-1407.

Related Service Information Under 1 CFR Part 51

EASA AD 2022–0157 specifies procedures for replacement of affected APU LP SOVs with serviceable parts, a special detailed inspection of affected engine LP SOVs and APU ISOVs for discrepancies (leaks), and replacement of discrepant engine LP SOVs and APU ISOVs with serviceable parts. EASA AD 2022–0157 also prohibits installation of an affected APU LP SOV, engine LP SOV, or APU ISOV. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI described above. The FAA is issuing this NPRM after determining

that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2022–0157 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2022–0157 by reference in the FAA final rule. This proposed AD would, therefore, require

compliance with EASA AD 2022–0157 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same, as the heading of a particular section in EASA AD 2022–0157 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2022–0157. Service information required by EASA AD 2022–0157 for compliance will be available at *regulations.gov* under Docket No. FAA–2022–1407 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 69 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Up to 15 work-hours × \$85 per hour = \$585	\$0	\$585	\$40,365

The FAA estimates the following costs to do any necessary on-condition actions that would be required based on

the results of any required actions. The FAA has no way of determining the

number of aircraft that might need these on-condition actions:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
Up to 7 work-hours × \$85 per hour = \$595	Up to \$18,000	\$18,595

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce.

This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus SAS Airplanes: Docket No. FAA–2022–1407; Project Identifier MCAI–2022–01043–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by December 19, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Airbus SAS Model A350–941 and –1041 airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 28, Fuel System.

(e) Unsafe Condition

This AD was prompted by reports of potential foreign object debris (FOD) contamination of the thermal relief valve (TRV). The FAA is issuing this AD to address potential FOD contamination, which could lead to a fuel leak. The unsafe condition, if not addressed, could result in an auxiliary power unit (APU) or engine fire and contribute to an uncontrolled fire, possibly resulting in loss of control of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraphs (h) and (i) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2022–0157, dated August 4, 2022 (EASA AD 2022–0157).

(h) Exceptions to EASA AD 2022–0157

(1) Where EASA AD 2022–0157 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where paragraph (3) of EASA AD 2022–0157 specifies “any discrepancy” this AD defines discrepancy as leaks of the APU, the engine low pressure (LP) shut-off valve (SOV), and the APU isolation shut-off valve (ISOV).

(3) The “Remarks” section of EASA AD 2022–0157 does not apply to this AD.

(4) Where the service information referenced in EASA AD 2022–0157 specifies

to scrap certain parts, send those parts to the manufacturer, or check spares, this AD does not include that requirement.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2022–0157 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraph (j)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Additional Information

For more information about this AD, contact Hassan Ibrahim, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206–231–3653; email Hassan.M.Ibrahim@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2022–0157, dated August 4, 2022.

(ii) [Reserved]

(3) For EASA AD 2022–0157, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; website easa.europa.eu. You may find this EASA AD on the EASA website at ad.easa.europa.eu.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on October 27, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–23808 Filed 11–3–22; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2022–1401; Project Identifier AD–2022–01017–E]

RIN 2120–AA64

Airworthiness Directives; General Electric Company Turbofan Engines

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain General Electric Company (GE) CF6–80E1A2, CF6–80E1A3, CF6–80E1A4, and CF6–80E1A4/B model turbofan engines. This proposed AD was prompted by a manufacturer investigation that revealed that certain compressor discharge pressure seals (CDP seals) and forward outer seals were manufactured from powder metal material suspected to contain iron inclusion. This proposed AD would require the replacement of the affected CDP seals and forward outer seals. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by December 19, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR