

# Proposed Rules

Federal Register

Vol. 87, No. 248

Wednesday, December 28, 2022

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2022-1655; Project Identifier MCAI-2022-00887-T]

RIN 2120-AA64

#### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all Airbus SAS Model A330-201, -202, -203, -301, -302, and -303 airplanes. This proposed AD was prompted by reports of corrosion and cracks found on engine inlet attach fittings. This proposed AD would require an inspection to determine whether affected engine inlet attach fittings (brackets) are installed, and replacement of those affected engine inlet attach fittings or replacement with an inlet cowl having no affected engine inlet attach fittings, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). This proposed AD would also prohibit the installation of affected parts. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by February 13, 2023.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room

W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

*AD Docket:* You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2022-1655; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

*Material Incorporated by Reference:*

- For material that is proposed for IBR in this NPRM, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](https://easa.europa.eu). You may find this material on the EASA website at [ad.easa.europa.eu](https://ad.easa.europa.eu). It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2022-1655.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**FOR FURTHER INFORMATION CONTACT:**

Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3229; email [vladimir.ulyanov@faa.gov](mailto:vladimir.ulyanov@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-1655; Project Identifier MCAI-2022-00887-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the

following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](https://www.regulations.gov), including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

**Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3229; email [vladimir.ulyanov@faa.gov](mailto:vladimir.ulyanov@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

**Background**

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2022-0133, dated July 5, 2022 (EASA AD 2022-0133) (also referred to as the MCAI), to correct an unsafe condition for all Airbus SAS Model A330-201, -202, -203, -301, -302, and -303 airplanes. The MCAI states that findings of corrosion and cracks on engine inlet attach fittings have been reported. It was determined that the affected fittings are susceptible to stress corrosion cracking. The MCAI notes that stress corrosion cracking, if not detected and corrected, could lead to failure of one or more fittings, possibly resulting in damage to the airplane or injury to occupants.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA-2022-1655.

**Related Service Information Under 1 CFR Part 51**

EASA AD 2022-0133 specifies procedures for an inspection to determine whether affected engine inlet attach fittings (those having certain part numbers and made of aluminum alloy 7175-T66 or 7075-T6) are installed, and replacement of those affected engine inlet attach fittings with serviceable parts or replacement with an inlet cowl having no affected engine inlet attach fittings. EASA AD 2022-0133 also prohibits the installation of affected parts. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES**.

**FAA’s Determination**

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, it has notified the

FAA of the unsafe condition described in the MCAI described above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements in This NPRM**

This proposed AD would require accomplishing the actions specified in EASA AD 2022-0133 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

**Explanation of Required Compliance Information**

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2022-0133 by reference in the FAA final rule. This

proposed AD would, therefore, require compliance with EASA AD 2022-0133 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2022-0133 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2022-0133. Service information required by EASA AD 2022-0133 for compliance will be available at *regulations.gov* under Docket No. FAA-2022-1655 after the FAA final rule is published.

**Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 11 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
5 work-hours × \$85 per hour = \$425 .....	None .....	\$425	\$4,675

The FAA estimates the following costs to do any necessary on-condition action that would be required based on

the results of any required actions. The FAA has no way of determining the

number of aircraft that might need this on-condition action:

**ESTIMATED COSTS OF ON-CONDITION ACTIONS**

Labor cost	Parts cost	Cost per product
210 work-hours × \$85 per hour = up to \$17,850 per nacelle .....	Up to \$10,136 .....	Up to \$27,986 per nacelle.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds

necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Airbus SAS:** Docket No. FAA–2022–1655; Project Identifier MCAI–2022–00887–T.

#### (a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by February 13, 2023.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to all Airbus SAS Model A330–201, –202, –203, –301, –302, and –303 airplanes, certificated in any category.

#### (d) Subject

Air Transport Association (ATA) of America Code 71, Powerplant.

#### (e) Unsafe Condition

This AD was prompted by reports of corrosion and cracks found on engine inlet attach fittings. The FAA is issuing this AD to detect and correct stress corrosion cracking. The unsafe condition, if not addressed, could result in failure of one or more fittings, possibly resulting in damage to the airplane or injury to occupants.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Requirements

Except as specified in paragraphs (h) and (i) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2022–0133, dated July 5, 2022.

#### (h) Exceptions to EASA AD 2022–0133

(1) Where EASA AD 2022–0133 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2022–0133 does not apply to this AD.

#### (i) No Reporting Requirement

Although the service information referenced in EASA AD 2022–0133 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

#### (j) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraph(s) (i) and (j)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (k) Additional Information

For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206–231–3229; email [vladimir.ulyanov@faa.gov](mailto:vladimir.ulyanov@faa.gov).

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2022–0133, dated July 5, 2022.

(ii) [Reserved]

(3) For EASA AD 2022–0133, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](http://easa.europa.eu). You may find this EASA AD on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu).

(4) You may view this service information at the FAA, Airworthiness Products Section,

Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: [www.archives.gov/federal-register/cfr/ibr-locations.html](http://www.archives.gov/federal-register/cfr/ibr-locations.html).

Issued on December 21, 2022.

**Christina Underwood,**

*Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2022–28241 Filed 12–27–22; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2022–1656; Project Identifier AD–2022–01081–A]

RIN 2120–AA64

#### Airworthiness Directives; Allied Ag Cat Productions, Inc. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for Allied Ag Cat Productions, Inc. (Allied Ag Cat) Model G–164A and G–164B airplanes with certain supplemental type certificates (STCs) installed. This proposed AD was prompted by an accident involving an Allied Ag Cat Model G–164B airplane where the propeller pitch control (PPC) linkage detached from the PPC of the engine and resulted in an accident that significantly damaged the airplane and injured the pilot. This proposed AD would require installing a secondary retention feature (bolt, washer, and safety wire) on the PPC lever and the PPC assembly. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by February 13, 2023.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](http://regulations.gov). Follow the instructions for submitting comments.

- *Fax:* (202) 493–2251.