

TABLE 7—MODIFICATIONS APPLICABLE TO ASTM F3198–18 “STANDARD SPECIFICATION FOR LIGHT SPORT AIRCRAFT MANUFACTURER’S CONTINUED OPERATIONAL SAFETY (COS) PROGRAM”

Requirement:

Include all sections of ASTM F3198–18 *except*:

- Section 1 and all subsections
- Section 5.2 and all subsections
- Section 5.3 and all subsections
- Section 6.1.1.3
- Section 6.1.1.4
- Section 7.7 and all subsections
- Section 8.1.2.1
- Section 8.2 and all subsections
- Section 10

Change section 4.1 to: “The purpose of this specification is to establish, by the manufacturer, a method by which unsafe conditions and service difficulty issues are reported, evaluated, and corrected. The type certificate holder is responsible to report failures, malfunctions or defects to the FAA as outlined in § 21.3.”

Replace “manufacturer” with “type certificate holder” throughout section 7.

TABLE 8—FAA VALIDATION OF EASA STATE OF DESIGN RECIPROCATING AIRCRAFT ENGINES

[In addition to the EASA CS–E, amendment 6 requirements,<sup>3</sup> the following requirements from 14 CFR part 33, amendment 33–34 also apply.]

Subject	14 CFR part 33
Instructions for Continued Airworthiness (ICA) .....	Section 33.4, appendices A33.1(b), A33.2, A33.3(b) and (c), and A33.4(a)(2).
Engine ratings and operating limitations including reciprocating engine limits.	Sections 33.7(b)(6) and (b)(8).
Durability (Propeller blade pitch control systems) .....	Section 33.19(b).
Turbine, compressor, fan, and turbosupercharger rotor overspeed .....	Section 33.27.
Turbocharger rotors .....	Section 33.34.
Lubrication system .....	Sections 33.39(a) and (c).
Vibration test .....	Sections 33.43(a) and (c).
Endurance test .....	Section 33.49(d).

Issued in Kansas City, Missouri, on 24 August, 2023.

**Patrick R. Mullen,**

*Manager, Technical Policy Branch, Policy and Standards Division, Aircraft Certification Service.*

[FR Doc. 2023–18679 Filed 8–30–23; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA–2023–1723; Project Identifier MCAI–2023–00457–T]

**RIN 2120–AA64**

**Airworthiness Directives; Airbus SAS Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all

Airbus SAS Model A330–200 Freighter series airplanes. This proposed AD was prompted by a widespread fatigue damage (WFD) evaluation on Airbus SAS Model A330–200 Freighter series airplanes, which found that the circumferential joint at Frame 58 (near the rear fuselage) is susceptible to WFD. This proposed AD would require a modification to reinforce the circumferential joints at Frame 58 and, if necessary, corrective action, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by October 16, 2023.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

*AD Docket:* You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2023–1723; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

*Material Incorporated by Reference:*

- For material that is proposed for IBR in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](https://www.easa.europa.eu). You may find this material on the EASA website at

<sup>3</sup> CS–E, Amendment 6—Aircraft cybersecurity.

*ad.easa.europa.eu*. It is also available at *regulations.gov* under Docket No. FAA–2023–1723.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

**FOR FURTHER INFORMATION CONTACT:** Tim Dowling, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 206–231–3667; email: *timothy.p.dowling@faa.gov*.

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2023–1723; Project Identifier MCAI–2023–00457–T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to *regulations.gov*, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

**Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Tim Dowling, Aviation Safety Engineer, FAA, 1600

Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 206–231–3667; email: *timothy.p.dowling@faa.gov*. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

**Background**

Fatigue damage can occur locally, in small areas or structural design details, or globally, in widespread areas. Multiple-site damage is widespread damage that occurs in a large structural element such as a single rivet line of a lap splice joining two large skin panels. Widespread damage can also occur in multiple elements such as adjacent frames or stringers. Multiple-site damage and multiple-element damage cracks are typically too small initially to be reliably detected with normal inspection methods. Without intervention, these cracks will grow, and eventually compromise the structural integrity of the airplane. This condition is known as WFD. It is associated with general degradation of large areas of structure with similar structural details and stress levels. As an airplane ages, WFD will likely occur, and will certainly occur if the airplane is operated long enough without any intervention.

An FAA final rule (“Aging Airplane Program: Widespread Fatigue Damage;” 75 FR 69746, November 15, 2010) became effective on January 14, 2011, and amended 14 CFR parts 25, 26, 121, and 129 (commonly known as the WFD rule). The WFD rule requires certain actions to prevent structural failure due to WFD throughout the operational life of certain existing transport category airplanes and all of these airplanes that will be certificated in the future. Design approval holders (DAHs) of existing and future airplanes subject to the WFD rule are required to establish a limit of validity (LOV) of the engineering data that support the structural maintenance program. Operators affected by the WFD rule may not fly an airplane beyond its LOV, unless an extended LOV is approved.

The WFD rule does not require identifying and developing maintenance actions if the DAHs can show that such actions are not necessary to prevent WFD before the airplane reaches the LOV. Many LOVs, however, do depend on accomplishment of future maintenance actions. As stated in the WFD rule, any maintenance actions necessary to reach the LOV will be mandated by airworthiness directives through separate rulemaking actions.

In the context of WFD, this action is necessary to enable DAHs to propose

LOVs that allow operators the longest operational lives for their airplanes, and still ensure that WFD will not occur. This approach allows for an implementation strategy that provides flexibility to DAHs in determining the timing of service information development (with FAA approval), while providing operators with certainty regarding the LOV applicable to their airplanes.

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2023–0053, dated March 14, 2023 (EASA AD 2023–0053) (also referred to as the MCAI), to correct an unsafe condition for all Airbus SAS Model A330–223F and –243F airplanes. The MCAI states that within the scope of WFD evaluations on Model A330–200 Freighter series airplanes, it was determined that the circumferential joint at Frame 58 (near rear fuselage) is susceptible to WFD. WFD, if not corrected, may lead to crack initiation and undetected propagation, which could affect the structural integrity of the airplane.

The FAA is proposing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA–2023–1723.

**Related Service Information Under 1 CFR Part 51**

EASA AD 2023–0053 specifies procedures for a modification (including rotating probe inspections for discrepancies and measurement of the maximum hole diameter at any point in the fastener hole bores on the circumferential joints) to reinforce the circumferential joints at Frame 58 and, if any discrepancies (cracking) are found, corrective action (contacting the manufacturer for instructions and accomplishing those instructions). This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES**.

**FAA’s Determination**

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements in This NPRM**

This proposed AD would require accomplishing the actions specified in EASA AD 2023–0053 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

**Explanation of Required Compliance Information**

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2023–0053 by reference in the FAA final rule. This

proposed AD would, therefore, require compliance with EASA AD 2023–0053 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2023–0053 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2023–0053. Service information required by EASA AD 2023–0053 for compliance will be available at *regulations.gov* under Docket No. FAA–2023–1723 after the FAA final rule is published.

**Explanation of Compliance Time**

The compliance time for the replacement specified in this proposed AD for addressing WFD was established to ensure that certain structure is replaced before WFD develops in airplanes. Standard inspection techniques cannot be relied on to detect WFD before it becomes a hazard to flight. The FAA will not grant any extensions of the compliance time to complete any AD-mandated service bulletin related to WFD without extensive new data that would substantiate and clearly warrant such an extension.

**Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 6 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
368 work-hours × \$85 per hour = \$31,280 .....	\$7,700	\$38,980	\$233,880

The FAA has received no definitive data on which to base the cost estimates for the on-condition actions specified in this proposed AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the

national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Airbus SAS:** Docket No. FAA–2023–1723; Project Identifier MCAI–2023–00457–T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by October 16, 2023.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all Airbus SAS Model A330–223F and –243F airplanes, certificated in any category.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Unsafe Condition**

This AD was prompted by a widespread fatigue damage (WFD) evaluation on Model A330–200 Freighter series airplanes, which found that the circumferential joint at Frame 58 (near the rear fuselage) is susceptible to WFD. The FAA is issuing this AD to address WFD in the affected area. The unsafe condition, if not corrected, may lead to crack initiation and undetected propagation, which could affect the structural integrity of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2023-0053, dated March 14, 2023 (EASA AD 2023-0053).

**(h) Exceptions to EASA AD 2023-0053**

(1) Where EASA AD 2023-0053 refers to its effective date, this AD requires using the effective date of this AD.

(2) This AD does not adopt the "Remarks" section of EASA AD 2023-0053.

(3) Where paragraph (2) of EASA AD 2023-0053 specifies "if, during the accomplishment of any inspection, which is part of the modification as required by paragraph (1) of this AD, any discrepancy, as identified in the SB, is detected, before next flight, contact Airbus for approved instructions and accomplish those instructions accordingly," this AD requires replacing those words with "if, during the accomplishment of any inspection, which is part of the modification as required by paragraph (1) of this AD, any cracking is detected, the cracking must be repaired before further flight using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature."

**(i) Additional AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraph (i)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified

as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

**(j) Additional Information**

For more information about this AD, contact Tim Dowling, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 206-231-3667; email: [timothy.p.dowling@faa.gov](mailto:timothy.p.dowling@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2023-0053, dated March 14, 2023.

(ii) [Reserved]

(3) For EASA AD 2023-0053, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](http://easa.europa.eu). You may find this EASA AD on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu).

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: [www.archives.gov/federal-register/cfr/ibr-locations.html](http://www.archives.gov/federal-register/cfr/ibr-locations.html).

Issued on August 24, 2023.

**Victor Wicklund,**

*Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2023-18693 Filed 8-30-23; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2023-1810; Project Identifier MCAI-2023-00267-T]

RIN 2120-AA64

**Airworthiness Directives; Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus Canada Limited Partnership Model BD-500-1A11 airplanes. This proposed AD was prompted by a manufacturing issue with an electrical connector that may prevent the connector from self-locking. This proposed AD would require removing the affected connector, installing a new connector, and testing the emergency power supply units (EPSUs), as specified in a Transport Canada AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by October 16, 2023.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](http://regulations.gov). Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

*AD Docket:* You may examine the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA-2023-1810; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.